Supplemental Reprogramming Tool (SRT 8432) Issue: Flash Download Failed

859 Will Flickema Wed, Apr 18, 2018 <u>Supplemental Reprogramming Tool (SRT 8432)</u> 3781

DESCRIPTION:

- Some 2001 to 2005 ST22 Sebring/Stratus 3.0L PCM/ECM flashes require the use of the SRT 8432 device with the TechTOOLs application.
- When selecting the appropriate flash file to download and clicking on download/update, you may receive the message, "Flash Download Failed. Close this window and try again" near 3% of the download complete (see below).



ESOLUTION:

- 1. Close out of the Flash Download/Update Progress window as prompted above.
- 2. Click on **Device Options** near the top left of the TechTOOLs application (see below).
- 3. Select COM Port Settings.

🕌 TechTOOLS R10.01			
<u>F</u> ile	Device Options	Help	
VIN : Mileag Control	Device Update		
	Make International Super Card 94-97		
	Module Replacement		
Flash	COM Port Settings		

4. Select the **SRT 8432** from the Device Option drop-down menu, and select the **COM1** as the COM Ports option drop-down menu.

5. Click **Update** (see below).

Scom Port Settings Dialog		
Devices:	SRT 8432 COM Ports: COM	1 💌
	Update Cancel	

- 6. You will receive the message shown below. The COM Port 1 has now been configured to use with the SRT 8432.
- 7. Connect the SRT 8432 to the PC and then restart the TechTOOLs application as prompted.



- 8. After relaunching TechTOOLs, select the appropriate flash file to download and click on the **Download/Update icon**.
- 9. You should now be able to successfully download the chosen flash file to the SRT 8432 tool.

Online URL: https://kb.fcawitech.com/article/supplemental-reprogramming-tool-srt-8432-issue-flashdownload-failed-859.html